element, was approximately 1 percent in the pressure measuring system and $4~\rm per$ cent in the strain measurement circuit.

Test Procedure

As previously stated, all the data in this study was obtained from cylinders laterally supported by restraining containers during autofrettage. The profitted percent bore enlargement was controlled by the outside diameter of specimen, thus controlling the subsequent expansion of each specimen. In to determine when the desired percent overstrain was obtained, the container was strain gaged using SR-4 type, Λ -7 gages tangentially directed and diametrically opposed at intervals along the length of the container. When a small, but substantial reading (generally between 100 and 200 μ in./in.), was obtained on all container gages, it was assumed that the specimen had uniformly contacted the container and uniform plastic flow achieved.

Strain readings from the languantial gages on the midsection of the specimen were recorded at appropriate intervals of induced internal pressure. From these data, plots of strain pressure vs. outside surface strain from both tangential strain gages a made for increasing and evereasing pressuron a few tests, longitude and main was measured by sing longitudinally oriented strain gages.

Physical dimensions of the property of the physical dimensions of the physical diameter, and length were measured, before and after the property of the physical diameter, and length were measured, before and after the physical diameter, and length were measured, before and after the physical diameter, and length were measured, before and after the physical diameter, and length were measured, before and after the physical diameter, and length were measured, before and after the physical diameter, and length were measured, before and after the physical diameter, and length were measured, before and after the physical diameter, and length were measured, before and after the physical diameter, and length were measured, before and after the physical diameter.

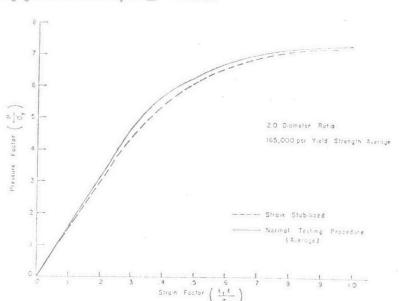


Fig. 5. Pressure factor vs. strain factor showing effect of strain stabilization.

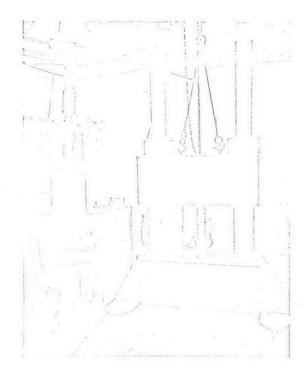


Fig. 3. 200,000 psi testing system.

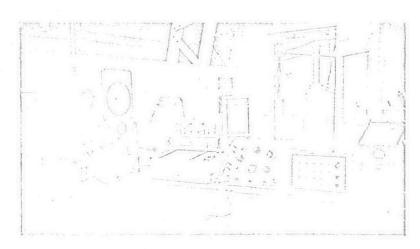


Fig. 4. Pressure and strain measurement equipment.